



Stellar

SHEET/ROLL GOODS | 37 OZ. NON-WOVEN BERBER

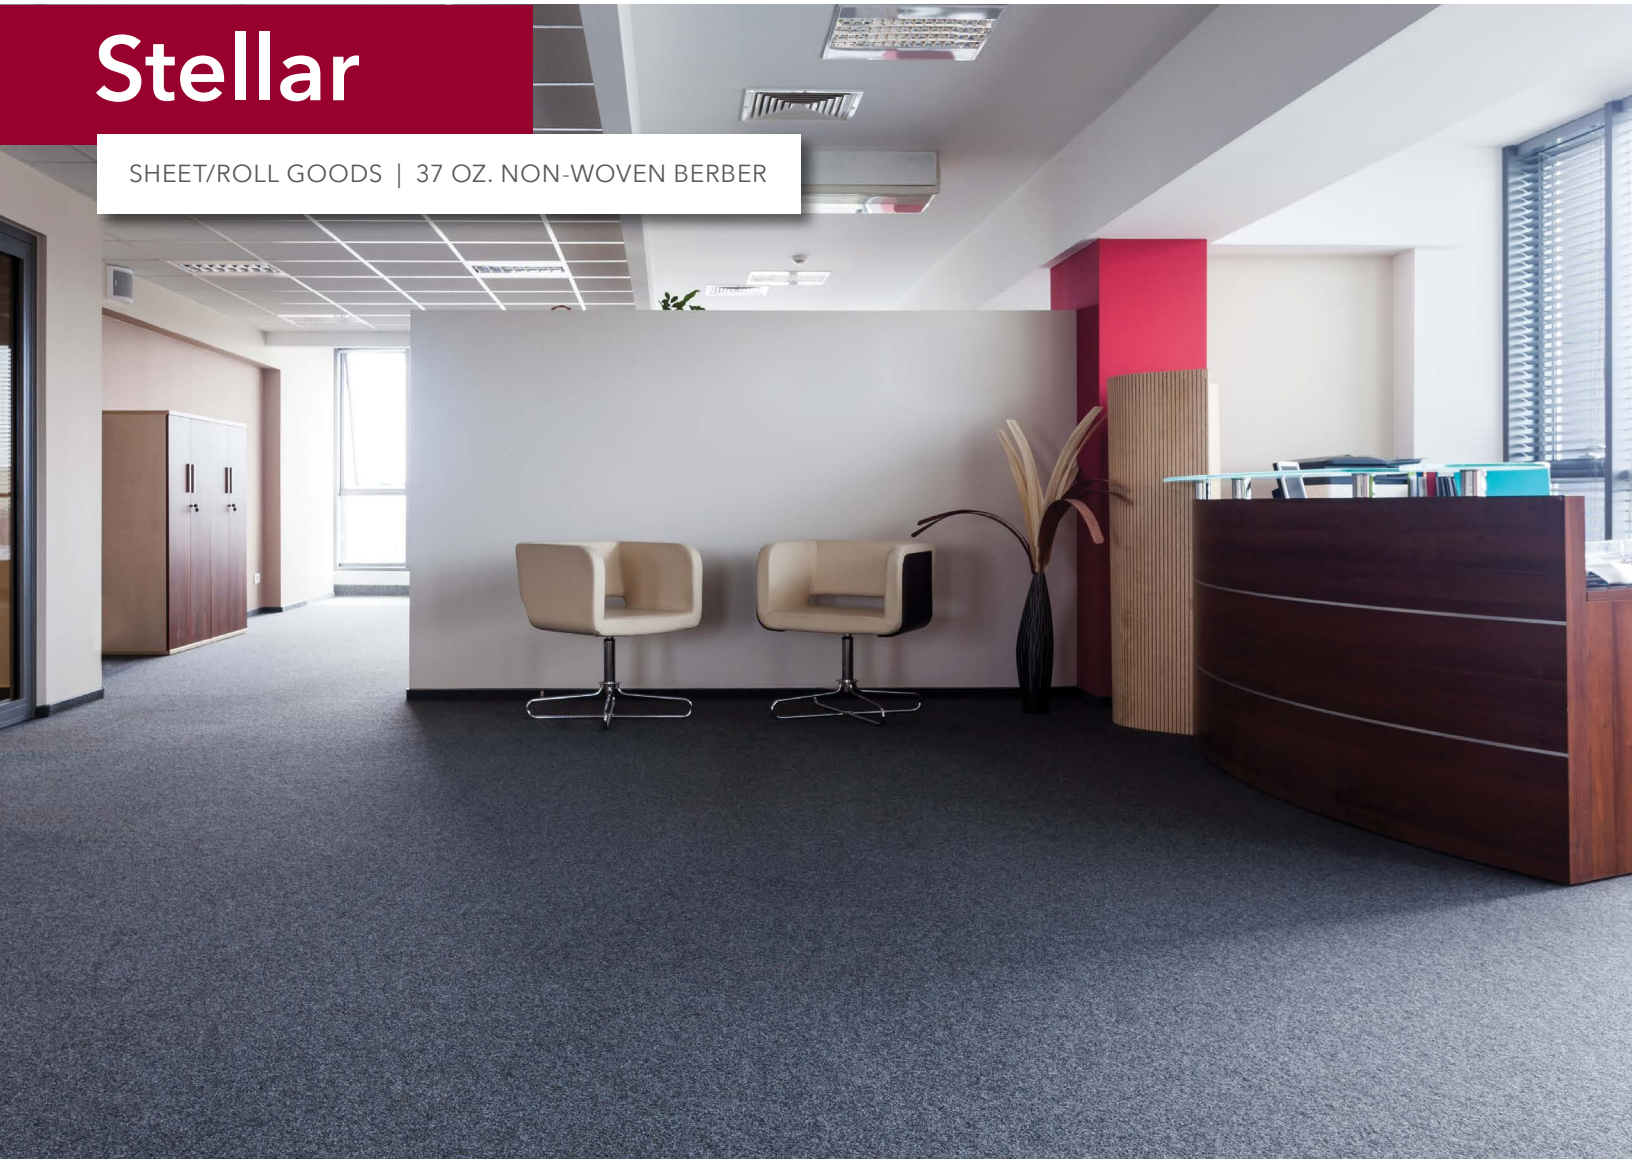

High-performance value and versatility.

Suitable for medium to heavy traffic areas, Stellar's heavy fiber and dense 37 oz. material prevents crushing while being easy to move or install. Stellar's solution-dyed, UV stabilized ASOTA™ polypropylene fiber and premium composite rubber backing make it resilient in extreme climate conditions, and easily cut into any shape without edge ravel.

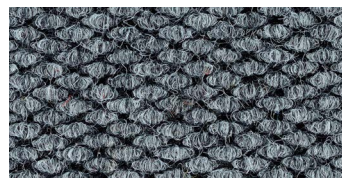


01. Grey 2344




02. Coal 2098




03. Icy Blue 5157

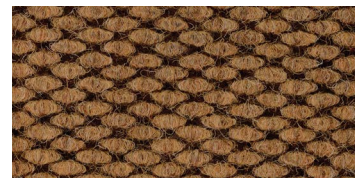

04. Bisque 1099

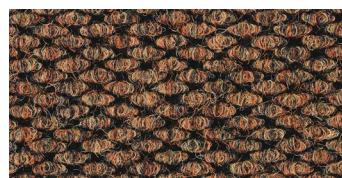

05. Amber 7006

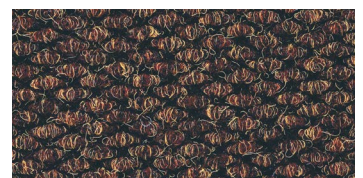

06. Dark Brown 7086



Your Source for
Commercial Fitness Flooring
(707) 823-4455 • www.langhornfci.com

Stellar



indoor/outdoor

SHEET/ROLL GOODS | 37 OZ. NON-WOVEN BERBER

SUGGESTED USES

Office Environments, Runners, Conference Rooms, Lobbies, Libraries, Retail/Department Stores, Entryways, etc.

Manufacturing Process:	Non-woven/needlepunched
Surface Aspect:	Hobnail (berber) pattern
Fiber:	100% Solution-dyed UV stabilized ASOTA™ polypropylene
Backing:	Premium composite rubber
Pile Height (± 0.5mm):	0.125"
Total Height (± 7.5%):	0.375"
Pile Weight (± 7.5%):	37 oz/sy
Total Weight (± 7.5%):	64 oz/sy
Sheet/Roll Width (± 2%):	6' 7" or 13' 2"

LIMITED WARRANTY

Full Commercial Warranty 1 year

Summary of Warranty

Products must be professionally installed to validate the warranty.

Langhorn Flooring Concepts Inc. warrants Stellar Sheet/Roll Goods against wear for a period of one year in a commercial application. This warranty applies only to material that is properly installed and maintained, while being used as intended and recommended. If the defect is covered by this warranty and is reported to Langhorn Flooring Concepts Inc. within the Warranty period, Langhorn Flooring Concepts Inc. will supply new material of same or similar grade to repair or replace the defective material.

- **Wear**
Defined as complete removal of wear layer, pattern and color due to wear from normal traffic and maintenance. If the wear occurs within one year from date of purchase, Langhorn Flooring Concepts Inc. will provide replacement materials or repair, of only the effected area.
- **Manufacturing Defects**
Langhorn Flooring Concepts Inc. warrants Stellar materials are free from manufacturing defects and will replace defective floor covering and reasonable installation costs for a period of up to one [1] year from date of purchase. Langhorn Flooring Concepts Inc. will not pay labor costs to repair or replace materials that defects were apparent before or at the time of installation.
- **Other Limitations**
 - This warranty is non-transferable
 - Manufacturing defect must be reported within 3 months from date of purchase.
 - This Warranty covers only properly installed & maintained floors
 - Langhorn Flooring Concepts Inc. excluded and will not pay for any consequential or incidental expenses.
 - Langhorn Flooring Concepts Inc. reserves the right of final judgment and may refuse claims in certain instances.

*For a copy of the full warranty please ask for a warranty sheet

PACKING & DIMENSIONS

Sheet/Roll Width (± 2%): 6' 7" or 13' 2"

TECHNICAL SPECIFICATIONS

Dimensional Stability (ASTM D7570-09):	Pass
Electrostatic Propensity (EN 1815):	>2kV
Electrical Resistivity (IBM / ICL):	Pass, for R.H. ≥40%
Sound Insulation (ISO 10140-1:2010):	≥21 dB
Thermal Retention (ISO 11092):	0.15 m K/W Pass

COLOR FASTNESS

To Light (ISO 105 B02):	5
To Water (ISO 105 E01):	5
To Shampoo (ISO 105 C06):	4-5
To Rubbing (ISO 105 X12):	4 (Dry), 3-4 (Wet)

FLAMMABILITY RATING

Smoke Density (ASTM E662)	Pass
Surface Flammability (FF 1-70 / ASTM D2859)	Pass

LEED-NC

MR Credit 4 | IEQ Credits 4.1, 4.3, 5

MAINTENANCE

Regular vacuuming (Weekly in low-traffic areas, and daily or twice daily in areas with higher traffic) with a motor-driven brush and beater bar can remove up to 80% of surface dirt, and is the easiest way to prolong the life of your carpet.

Regular vacuuming is key to maintaining your carpet, but eventually the carpet color dulls from dirt and grime stuck in the fibers. The dirt is then carried further into the building to form more soil reservoirs. Additionally, the oil content (15%) of the soil causes particles to stick to carpet fiber and resist vacuuming. To restore the carpet to its best condition, frequent light cleaning gives the best result and is often very cost effective.

IMPORTANT NOTICE

Sample swatches have been cut from an overall design; decoration and shade may vary.

YOUR AUTHORIZED SALES REPRESENTATIVE:

